Copyright of this drawing is vested in the Architect and it must not be copied or reproduced without consent. Figured dimensions only are to be taken from this drawing. All contractors must visit the site and be responsible for taking and checking all dimensions relative to their work. bpArchitecture are to be advised of any variation between drawings and site conditions.
DO NOT SCALE OFF THIS DRAWING.....IF IN DOUBT ASK

Rev.	Drawn	Comments	Date
-			

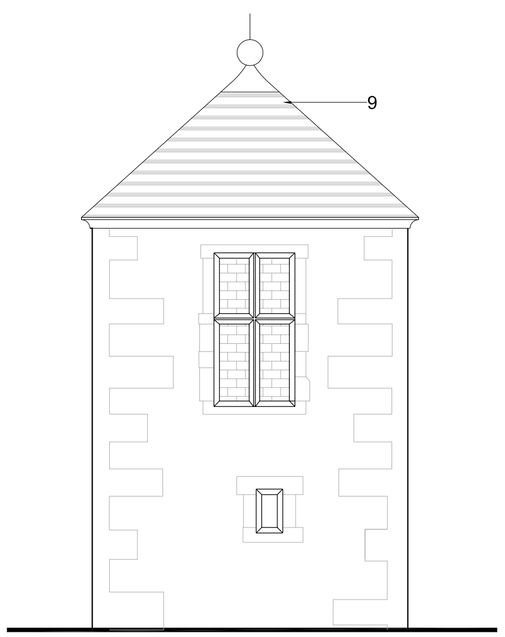

South Elevation

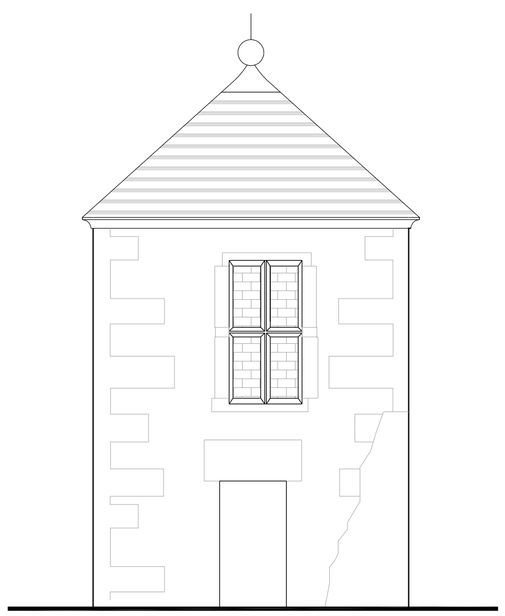

North Elevation

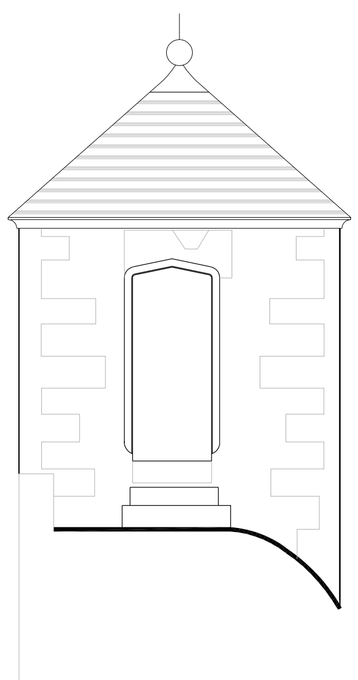

East Elevation

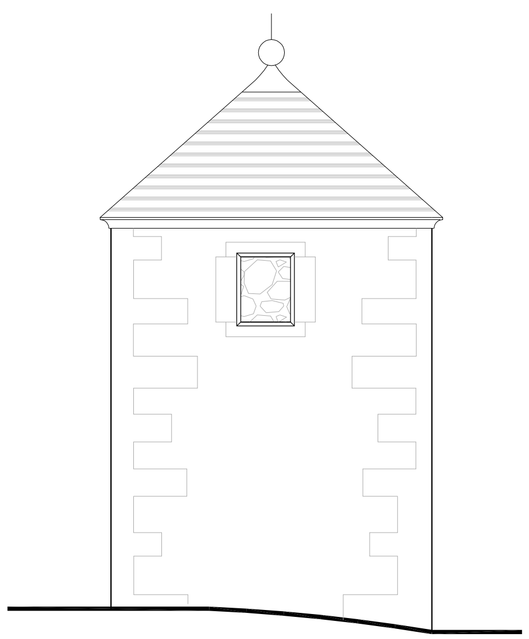

West Elevation

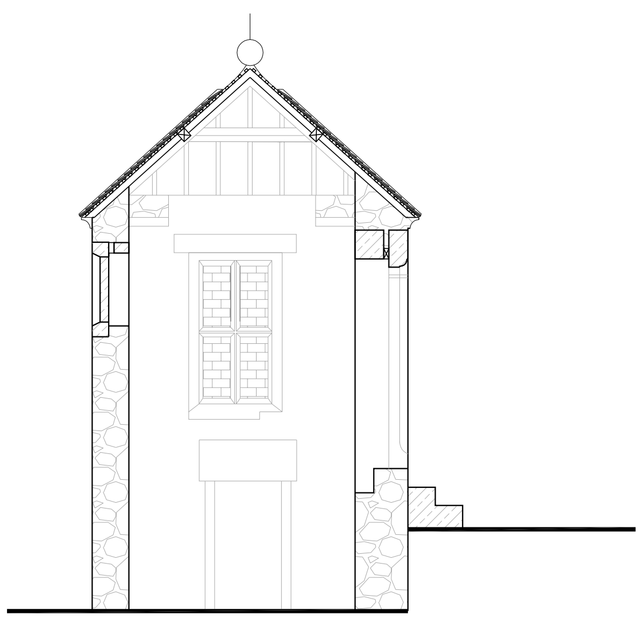

Section A-A

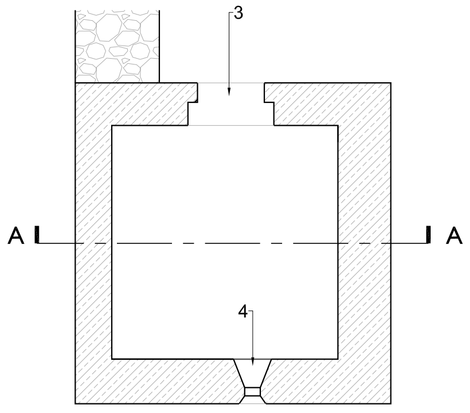

Lower Level Floor Plan

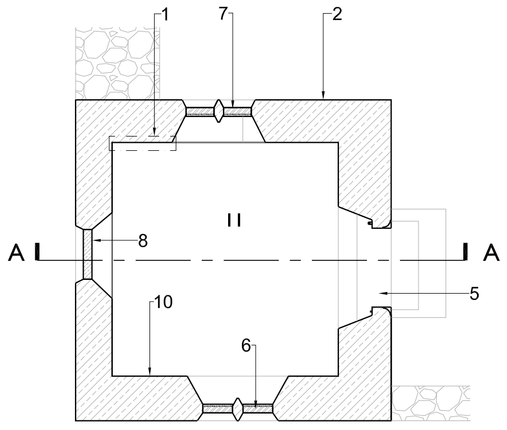

Upper Level Floor Plan

Materials

Flooring

Lower level Ground Floor has an earth floor and stone thresholds.

Upper floor level is missing completely.

Walls

Walls are regular coursed rubble grit stone walls with stone quoins.

Windows

There are two number cruciform window openings with splayed stone mullions. The wrought iron frames are missing and the window openings have been infilled with brick. Two other smaller windows to the south and west elevations have splayed openings. The western window has been infilled with rubble stone.

Doors

There are two number door openings to the north and east elevations, both doors are missing. An existing pin hinge latch and latch remain. The door opening to the east elevation has a pseudo four centred arch.

Roof

The pyramidal roof is finished with plain clay tiles and mortared onto battens with a lead sphere above.

Condition

1. Internal stonework has become loose and dislodged in the area to the side of the north window, this area needs to be inspected more closely and stones may need to be re-bedded.
2. All walls externally have missing mortar and will require re-pointing. Re-pointing is required in places internally.
3. North door is missing, pin hinges and latch fitting are missing, internal timber lintel is loose and has degraded, requires replacement.
4. Small southern small opening, proper inspection could not be obtained.
5. East door missing, 1no hinge pin and latch pin remain however have corrosion, timber lintel above door has been lost and needs replacement. Some stones are missing to the internal threshold area.
6. Southern cruciform window has been bricked up, internal plaster to splayed jambs remain, timber lintel above could not be inspected but will probably require replacement. Stones missing to the cill area.
7. Northern cruciform window has been bricked up, internal timber lintel has degraded and has become loose, replacement lintel is required. Some missing stones to internal window cill area.
8. Window has been infilled with rubble stone, window is missing and requires replacement.
9. The roof is generally sound, however there are some missing and displaced tiles. There is some cracking and missing mortar internally in which the tiles are attached. The lead sphere above appears to have been damaged.
10. The majority of the internal plaster is missing.
11. The first floor and its support structure is missing and will require replacement.

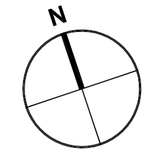



bpArchitecture
☎: 01782 515 555
✉: Enquiries@bpArchitecture.co.uk
: www.bparchitecture.co.uk
93 High Street Biddulph Staffs ST8 6AB
Architects - Interior Design - Conservation - Landscape

Client
Dr H Uppal

Project
Whitehough Hall Gazebo, Ipstones

Title
Existing Plan, Elevations and Section

Status
Stage 3: Planning

Date September 2016 Drawn SS

Scale @A1 1:50 Checked BSP

Project No 16-067 Drawing No. AS(0)03 Rev

A1 File Ref: BBA1