
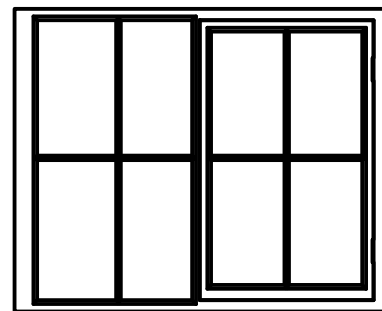


W03

AS EXISTING

PROPOSED

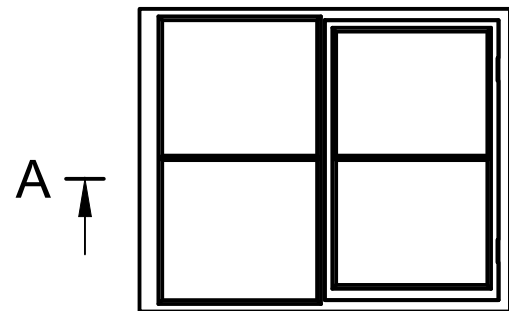


A-A (1:20)



B


B (1:5)

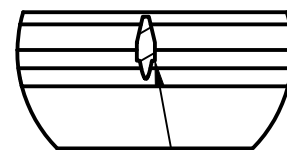

MUNTIN PROFILE TO MATCH EXISTING HORIZONTAL ELEMENTS

RESTORATION SCHEDULE:

ALL EXISTING TIMBER AND GLASS RETAINED WHERE POSSIBLE, SMALL SCARFED REPAIRS IN MATCHING REDWOOD MAY BE REQUIRED IN LOCALISED AREAS OF ROT. ANY DAMAGED OR C20 GLAZING TO BE REPLACED WITH ~2.5MM CYLINDER GLASS. ALL GLAZING SEALED WITH LINSEED OIL PUTTY. WINDOW HARDWARE RETAINED. REMOVAL OF C20 BRASS LOCKS. REPAINTED WITH HERITAGE PAINT IN OFF-WHITE TO MATCH ADJACENT MUSEUM COTTAGE.

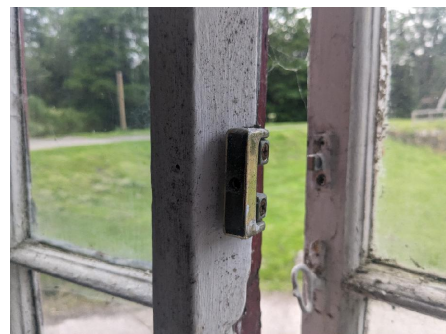

DRAWING No.	TITLE CH COTTAGE W03 E/P	DRAWN by Paul Statham		
MATERIAL:	THICKNESS:	Scale: 1:20		
FINISH AND TREATMENT:	<u>TOLERANCES UNLESS OTHERWISE STATED</u> MACHINING ±0.1mm FABRICATION WITHOUT WELDING ±0.5 mm FABRICATION WITH WELDING ±1.0mm MOULDING & CASTING ±2.0mm ALL DIMENSIONS IN MILLIMETRES SHARP EDGES TO BE REMOVED TO 0.5mm MAX DO NOT SCALE THIS DRAWING		IF IN DOUBT ASK	
		Rev.	Date of issue 22/07/2024	Sheet 1/1