



ARBORICULTURAL REPORT

Client: Lee Doyle

Site: The Dairy
Dalebank Road
Freehay
ST10 1RE

Date: 21 June 2021

Ref.: THL-R21-74

GROWING SINCE • 1982

TREE HERITAGE

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd Street, Leek, Staffordshire, ST13 5HP
Telephone: 01538 384019 • treeheritage.co.uk • info@treeheritage.co.uk



Constructionline

Registered in Wales: No. 01655803 Ford House, Market Street, Leek, Staffordshire, ST13 6JA VAT No: 368064436



CONTENTS

- 1.0 Introduction
- 2.0 Limitations of report
- 3.0 Method
- 4.0 Trees and Construction: General overview
- 5.0 Protection of trees that are retained
- 6.0 Arboricultural methods
- 7.0 Wildlife: timing of operations
- 8.0 Planning considerations
- 9.0 Arboricultural Impact Assessment
- 10.0 Cascade Chart for Tree Quality Assessment: Table 1 BS 5837:2012
- 11.0 Appendix A: Tree Survey Schedule
- 12.0 Appendix B: Tree Protection Barriers
- 13.0 Appendix C: Plans
 - 13.1 AIA Plan
 - 13.2 Tree Protection Plan
- 14.0 Appendix D: Driveways through tree RPA's



1.0 Introduction

- 1.1 The purpose of this report is to be an aid to the design of the layout of the site. It identifies the better trees and specifies necessary protective measures that are required to keep the trees within the development. It may also give recommendations for remedial work that may be desirable to keep or improve the quality of the trees.
- 1.2 The survey complies with British Standard 5837:2012 *Trees in relation to design, demolition and construction – Recommendations*. All significant trees on the site have been inspected including any that may be on the boundary or on adjacent land that may be affected by any development. Included in the schedule of trees are the Root Protections Areas (RPAs) which are designed to give the minimum functionally rooting area to ensure the healthy survival of the retained trees on site. The relevant distance from each tree from which construction work should be excluded by the erection of a Protective Barrier is also listed.
- 1.3 The site visit was on 18 May 2021. Surveyor: Ben Williams. The weather conditions: Clear and bright.

2.0 Limitations of report

- 2.1 The trees were inspected from ground level only and no invasive tools were used.
- 2.2 This report is valid for a period of 2 years as part of the planning application process. Due to the nature of trees the condition may change rapidly and therefore the safety of the trees cannot be guaranteed for the same period.
- 2.3 Trees may affect buildings by indirect influence of their roots on the substrate on which structures are built and by direct action on foundations, drains and other underground services. This report does not attempt to address these issues.
- 2.4 Trees are dynamic structures that can change rapidly and can never be guaranteed 100% safe: even if they were deemed safe on the day of the inspection, they can sometimes suffer damage in adverse weather conditions. All trees should be inspected following any bad weather.



3.0 Method

- 3.1 The survey was undertaken from ground level and includes all individual significant trees shown in position and numbered on the site plan. Some trees may be surveyed together and put in numbered groups e.g. G1, or woodlands e.g. W1. Hedges will also be listed e.g. H1.
The following information is collected and given in a schedule.

- Number
- Tree Species (Common Name)
- Height in metres
- Stem diameter at 1.5 metre above ground level in millimetres.
- Crown Spread at compass points NSEW in metres.
- Crown clearance (height of lowest branch above ground) in metres.
- First significant branch height (in metres) and direction (NSEW).
- Age Class (Young, Middle-aged, Mature, Over mature and Veteran)
- Physiological Condition (Good, Fair, Poor or Dead). This is an overall assessment of the health of the tree based on leaf size, colour, density, annual growth increments and die-back or dead wood.
- Structural Condition (comments on decay, cavities, disease and other defects and issues that will affect its suitability for retention).
- Recommendations (These are based on the previous two categories and may include pruning or removal amongst other recommendations).
- Estimated Remaining Contribution (in years <10, 10+, 20+, 40+)
- Category Grading:

U= Low valued tree (may be unsuitable for retention due to its poor condition or less than 10 years contribution).

A= High quality tree of good form with at least 40 years contribution.

B= Moderate quality tree with 20>40 years contribution.

C= Low quality tree (usually of poor form or condition). Also, trees of less than 150mm stem diameter (these may be considered for relocation).
Category C trees should not be considered as a planning constraint.

Subcategory:

1= mainly Arboricultural Merit

2= mainly Landscape Merit

3= mainly Cultural or Conservation Merit



4.0 Trees and Construction: General overview

4.1 Trees are large dynamic organisms that have basic requirements to survive. The obvious part of the tree is the trunks and branches with the leaves that are essential for survival and these are easily damaged by machines etc. This damage though is easily avoided and obvious when it occurs. They have roots that anchor the tree into the ground but also take up moisture and oxygen as well as nutrients from the soil. Most tree roots are in the upper 0.5 metres of the soil and can extend well beyond the extent of the trees leafy canopy. Roots are easily damaged during any construction process although sometimes the immediate effect is not obvious. The main threats from construction work come from:

- a) Compaction of the soil prevents gaseous exchange and water drainage.
- b) Roots being severed or crushed.
- c) Drainage being affected by alteration of levels and installation of trenches for services.
- d) Physical damage to branches and trunks.
- e) Poisoning of trees with contamination from fuel and oil leaks from machinery, run off from concrete mixers or other toxic materials used during construction.

The main consequences of the above in terms of damage are:

- i) Compaction kills roots by preventing oxygen and water take-up.
- ii) Severance can lead to pathogenic fungi invading the tree and in the worst cases, it can also lead to instability.
- iii) Loss of vitality caused by the above can dramatically affect the life span of the tree.
- iv) Damage to the crown can also lead to disease and instability in the worst cases.

5.0 Protection of the trees that are retained

5.1 BS 5837:2012 is intended to give recommendations to protect the trees during development and ensure their survival following the demolition or construction work. To achieve this there are two main considerations. The first is to protect the roots of the trees and the second to protect the upper parts of the trees, the trunk and branches.



- 5.2 The main tool to achieve the above is to create “Construction Exclusion Zones” (CEZ) around the trees. These are based on the “Root Protection Area” or RPA as calculated in BS 5837:2012. The RPAs for all the trees are included in the survey schedule. The RPA may be adjusted to consider existing ground constraints such as roads, buildings or walls. This will be done based on the surveyors’ experience and qualification on a tree by tree basis.
- 5.3 To achieve an effective “Construction Exclusion Zone” (CEZ) it is necessary to erect a protective barrier along the edge of the RPA’s. The details of this fencing are shown in Figure 2 or 3, which is included as an appendix (B) to this report. The barrier should be erected a minimum distance from each tree, this minimum distance is provided as a radius in the Survey Schedule and shown on the plan. It is essential that this barrier is well anchored into the ground to prevent it being moved. It is acceptable to use “Herras” fencing in concrete or rubber feet and appropriately back braced in areas where site circumstances and the associated risk of damaging incursion into the RPA are low.
- 5.4 The Tree Protective Fencing should be installed before any construction work takes place. This includes demolition, site clearance and drainage work.
- 5.5 Notices should be fixed to the fencing warning personnel not to enter. They should read “CONSTRUCTION EXCLUSION ZONE – NO ACCESS”. An example of this is attached in appendix (B).
- 5.6 In some circumstances, and only with agreement from the LPA, it may be necessary to work within the RPA. In these circumstances the barrier may need to be realigned and ground protection used even for access on foot. If vehicular access is required, then this will have to be specifically designed to prevent compaction and agreed in writing.
- 5.7 If the LPA agree to work within the RPA, then any excavation work would have to be done by hand and usually supervised by the Arboriculturalist. Drives or access roads will also require a specific Method Statement and include “No-Dig” construction methods.



- 5.8 Some operations such as the use of cranes for construction or demolition will need to be carefully organised and supervised to avoid accidental damage to the branches and stems of the retained trees. It may be advisable where damage is inevitable to carry out facilitation pruning to avoid initial conflict. This would have to be agreed by the Arboriculturalist and the LPA.
- 5.9 Trees should not be used to support notices and under no circumstances should nails, screws or bolts be driven into the trees. Likewise, trees should not be used to support cables or lights.
- 5.10 Care should be taken to avoid the discharge of any material that could contaminate the soil within 15 metres of any tree. This would include washings from cement mixers, fuel or oil storage etc. This distance may need to be extended if the ground slopes towards the tree.

6.0 Arboricultural Methods

- 6.1 The Arboriculturalist or the Local Authority Tree Officer should be consulted if there are any unforeseen issues in relation to any tree on site, including any unexpected work within the Root Protection Areas.
- 6.2 All tree work should be carried out by skilled professionals, and it is recommended that contractors are selected from the Approved List of Arboricultural Association Contractors. This can be obtained from www.trees.org.uk
- 6.3 All tree work should be carried out to the latest standards based on BS 3998: 2010 'Recommendations for Tree Work'.

7.0 Wildlife and Timing of Operations

- 7.1 Many animals including bats and birds are given special protection under the Wildlife and Countryside Act 1981(as amended) and the Countryside and Rights of Way Act 2001 amongst other legislation.



- 7.2 **Bats.** It is an offence to “intentionally or recklessly disturb a bat” or “damage, destroy or block the access to the resting place of any bat”. An assessment of trees on the site for “suitability for bats” is an essential part of the pre-planning stage. If bats are found or even reported to have used the trees for roosts, then it is essential that a specialist in this field is contacted for advice. Natural England should be contacted on 0300 060 3900 or through www.naturalengland.org.uk for details of suitable specialists. It may be that a European Protected Species Habitat Regulations Licence is required before work can continue. Following advice, it is usual that work to trees with potential for bat roosts is best done from late August to early October. March through to April is also suitable but there may be conflict with nesting birds. (see below)
- 7.3 **Birds.** It is an offence to disturb, injure or kill any bird whilst it is at or building a nest. This includes damage to or removal of the actual nest whilst it is in use or being built. Tree works that could lead to the above should therefore be avoided during the months of March through until August.
- 7.4 To avoid problems with either, it would be advisable to programme all necessary site clearance work and tree pruning from late August to the early October.

8.0 Planning Considerations

- 8.1 Full planning consent that includes any proposed tree works usually overrides the requirement to get specific permission, even for trees that are within a Conservation Area or protected by a Tree Preservation Order.
- 8.2 If work is to be carried out prior to planning consent being sought, then it may be necessary to apply for permission separately. In a Conservation Area it is a requirement to give Six Weeks Written Notice of any intended works. In the case of a TPO an application is required to the LPA on a 1APP form; in this case it may take 8-10 weeks before permission is given. It should be noted that permission is not required from the LPA to remove “Dead or Dangerous” trees although it is always best to inform the LPA of your intentions and supply suitable evidence to support your actions.



9.0 Arboricultural Impact Assessment

- 9.1 A total of 5 trees were included in the survey. All trees are listed in the survey schedule and shown on plan THL-0967 attached to this report.
- 9.2 The development consists of a driveway as shown on plan THL-0967. The driveway is already in place, but the concern is the impact it may have on the nearby trees.
- 9.3 Highlighted in yellow on the plan are two areas where the driveway encroaches into the RPA of the trees on site, T1 and T2. Frequently driving over through the RPA of the trees will compact the soil and may lead to the decline of the trees. To prevent the compaction of the soil, it is recommended that a 3D cellular confinement and load spreading system is used. This system will sit on top of the existing ground level and spread the weight of vehicle using the driveway. The soil may require decompaction prior to the installation of the cellular confinement system, this could be achieved with an air spade or decompaction dagger.
- 9.4 An example of the type of system that could be used, is attached in appendix D of this report. It is recommended that it is installed under Arboricultural Supervision.
- 9.5 The other 3 trees are located off site and will not be affected by the development. They are behind an existing hedge and fence line, which will act as suitable tree protection measures.
- 9.6 All retained trees will require protection during the construction work to make sure that they are not damaged. This can be achieved by creating a Construction Exclusion Zone (CEZ), using barriers to exclude vehicles, personnel and materials, details of this are found in section 5 of this report.
- 9.7 The exact position of the Tree Protection Barriers should be discussed on site with the agreement of the LPA Tree Officer. It is essential that they are erected before any work starts on the site. Plan THL-0967-2 shows the proposed locations for the barriers.

Tree Heritage Ltd

Ben Williams

Ben Williams

BSc (Hons) Arb. M.Arbor.A

21/06/2021

Table 1 Cascade chart for tree quality assessment

Category and definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention (see Note)				
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	- Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline - Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality <i>NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve; see 4.5.7.</i>			Red 
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation	
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	Light Green 
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	Mid Blue 
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	Grey 

Site: The Dairy, Cheadle
 Surveyed by: Ben Williams BSc (Hons) Arb. M.Arbor.A
 Date: 18/05/2021

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd St, Leek, Staffs, ST13 5HP
 T: 01538 384019 E: info@treeheritage.co.uk



APPENDIX A: TREE SURVEY SCHEDULE

KEY:

Measurements	Life Stage	Physiological Condition	Category Grading	Symbols
Height - Metres Stem Diameter - Millimetres at 1.5m above ground level Branch Spread - Metres (North, South, East and West) Crown Clearance - Metres RPA Radius - Metres Estimated Remaining Contribution - Years FSB - First Significant Branch - Metres	Y - Young SM - Semi-Mature EM - Early Mature M - Mature OM - Over-Mature V - Veteran	G - Good F - Fair P - Poor D - Dead	A - High (green) B - Moderate (blue) C - Low (grey) U - Poor/Trees for removal (red) Sub-Categories: 1 - Mainly Arboricultural value 2 - Mainly Landscape value 3 - Mainly Cultural value	< - Less than ~ - Approximately > - Greater than
RPA - Root protection area (equivalent to a circle with a radius 12x the stem diameter measured at 1.5m above ground level)				

Site: The Dairy, Cheadle

Surveyed by: Ben Williams BSc (Hons) Arb. M.Arbor.A

Date: 18/05/2021

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd St, Leek, Staffs, ST13 5HP


T: 01538 384019 E: info@treeheritage.co.uk

Tree Ref.	Species	Height	Stem Diameter	Branch Spread				Crown Clearance	FSB Height + Direction	Life Stage	Phys. Condition	Structural Condition	Recommendations	Estimated Remaining Contribution	Category Grading	RPA Radius
				N	S	E	W									
T1	Ulmus glabra (Wych Elm)	12	640	7.5	7	7	7.5	2.5	3(N)	M	Fair	Fungal brackets visible on stem. Decay present at base. Hanging branch/es in crown.	Remove hanging branch/es.	20+	B1	7.68
T2	Fraxinus excelsior (Ash)	12	600	8	8	8	8	4	4(SW)	M	Fair	Major deadwood in crown.	Remove major deadwood.	20+	B1	7.2
T3	Prunus domestica (Damson)	5	270	4	3	3	3.5	2	2(E)	OM	Poor	Declining. Decay present at base. Decay present in stem.	No work required.	<10	U	3.24
T4	Prunus domestica (Damson)	7	310	4	4	4	4	1	2(S)	OM	Poor	Declining. Decay present at base. Decay present in stem.	No work required.	<10	U	3.72
T5	Prunus avium (Wild Cherry)	8	510	5	5	6	5	1.5	2(S)	M	Fair	Dieback in crown. Major deadwood in crown.	No work required.	10+	C1	6.12

Appendix B i

Figure 2 – Default specification for protective barrier

Figure 2 Default specification for protective barrier

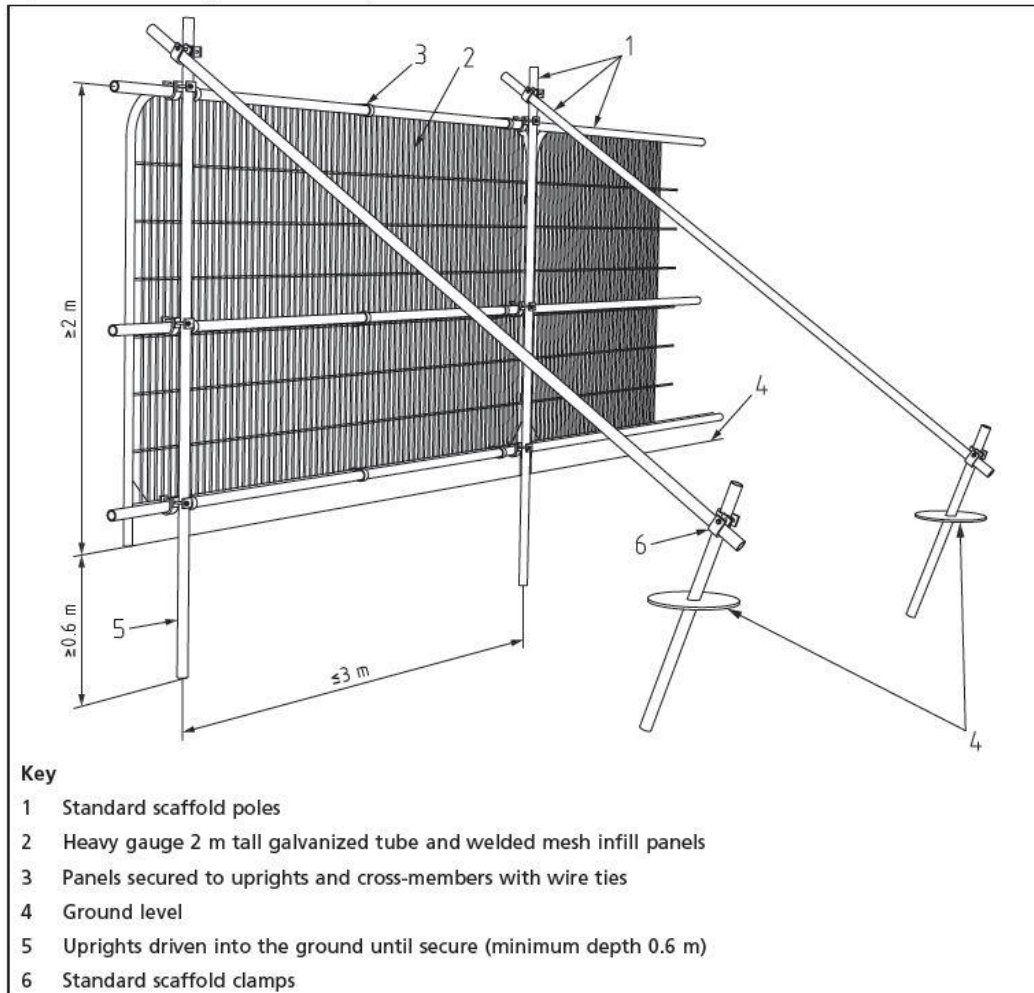




**PROTECTIVE FENCING. THIS
FENCING MUST BE
MAINTAINED IN ACCORDANCE
WITH THE APPROVED PLANS
AND DRAWINGS FOR THIS
DEVELOPMENT.**



**TREE PROTECTION AREA
KEEP OUT !**

**TREES ENCLOSED BY THIS FENCE ARE
PROTECTED BY PLANNING CONDITIONS**

**ANY INCURSION INTO THE PROTECTED AREA MUST BE
WITH THE WRITTEN PERMISSION OF THE LOCAL
PLANNING AUTHORITY**

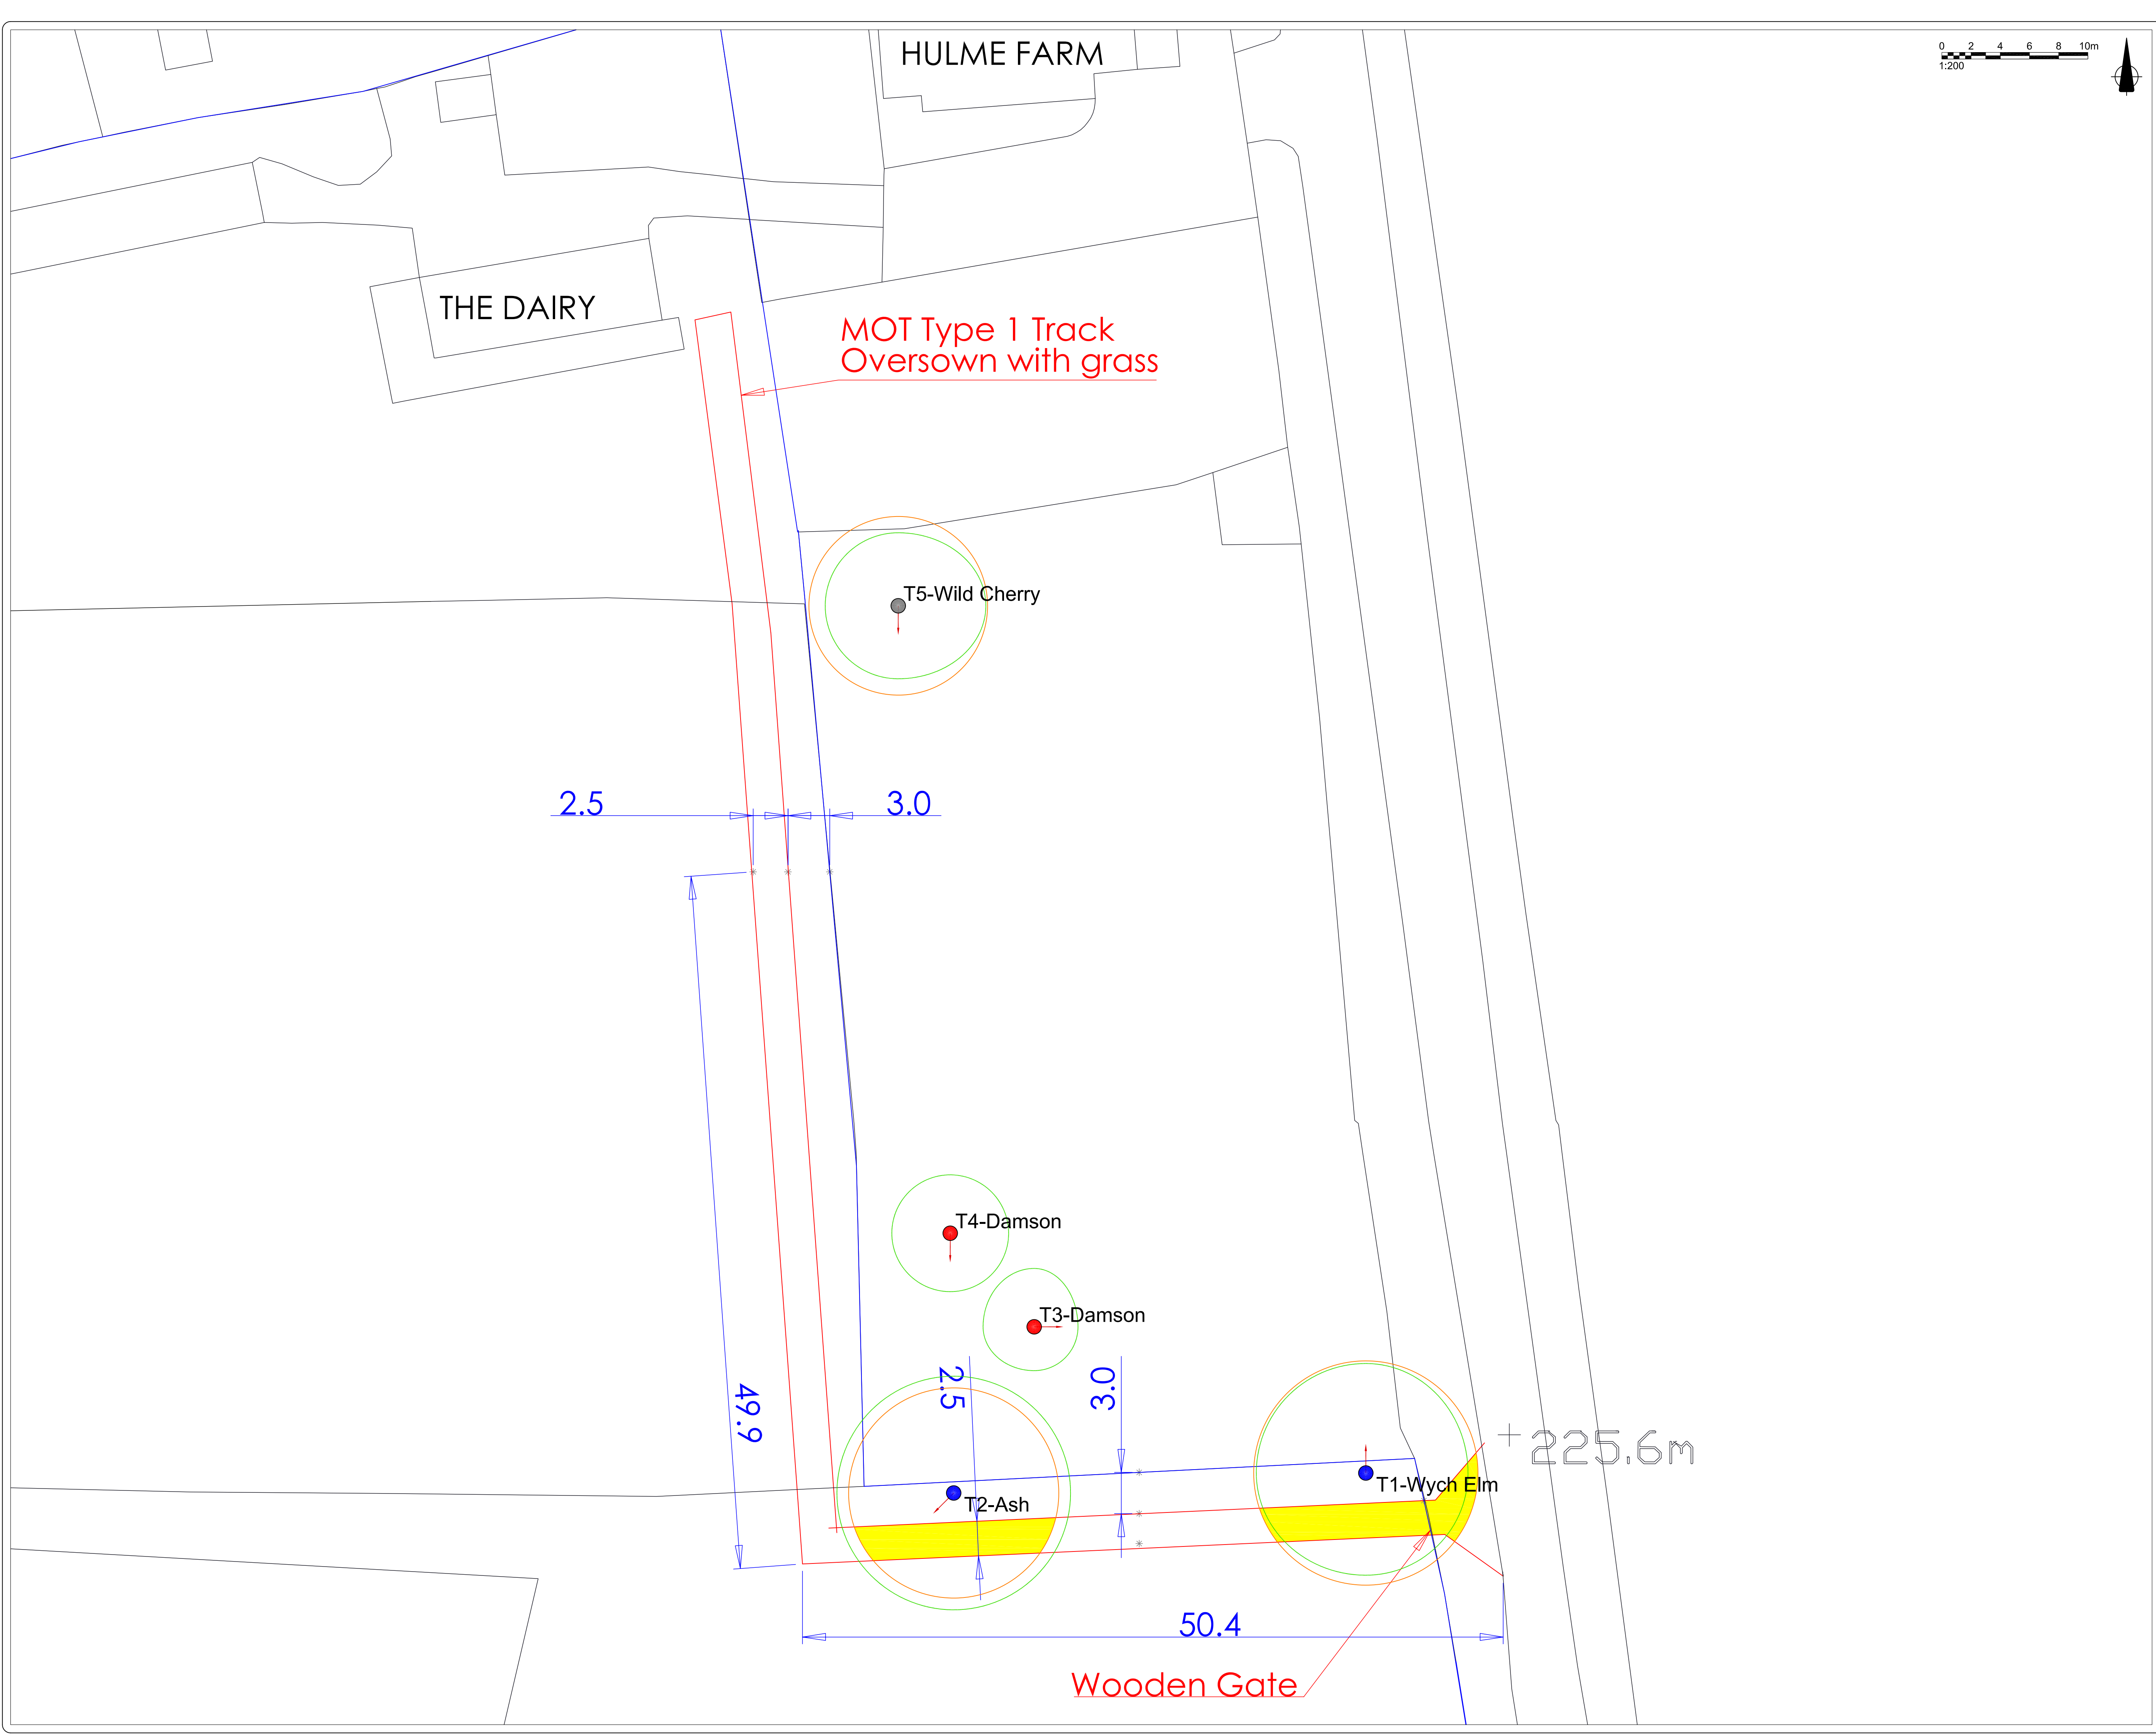

Notes:

1. Contractors are advised to check all dimensions against the tree schedule. Tree canopies are symbolic only and are representative of the average spread; this may not represent the true outline. Note that the tree stem may not sit centrally to canopy. Tree stems are symbolic only and are representative of the tree category; this does not represent the stem diameter - see schedule for details.

2. The original of this drawing was produced in colour - a monochrome copy should not be relied upon.

Rev.	Date:	Status/Amendments:	By:
------	-------	--------------------	-----

Key:

- Category A Tree / Group
- Category B Tree / Group
- Category C Tree / Group
- Category U Tree / Group
- Branch Spread
- Tree to be Removed
- Root Protection Area (RPA)
- First Significant Branch Direction
- Tree Protection Barrier
- Special Measures
- Tree Shadow

GROWING SINCE 1992

TREE HERITAGE

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd Street, Leek, Staffordshire, ST13 5HP

Telephone: 01538 384019

treeheritage.co.uk • info@treeheritage.co.uk

Client:

Lee Doyle


Project:

The Dairy, Dalebank Road, Freehay, ST10 1RE

Drawing Title:

Arboricultural Impact Assessment

Scale:	1:200	Paper Size:	A1
Drawing Number:	THL-0967	Date Created:	20/05/2021

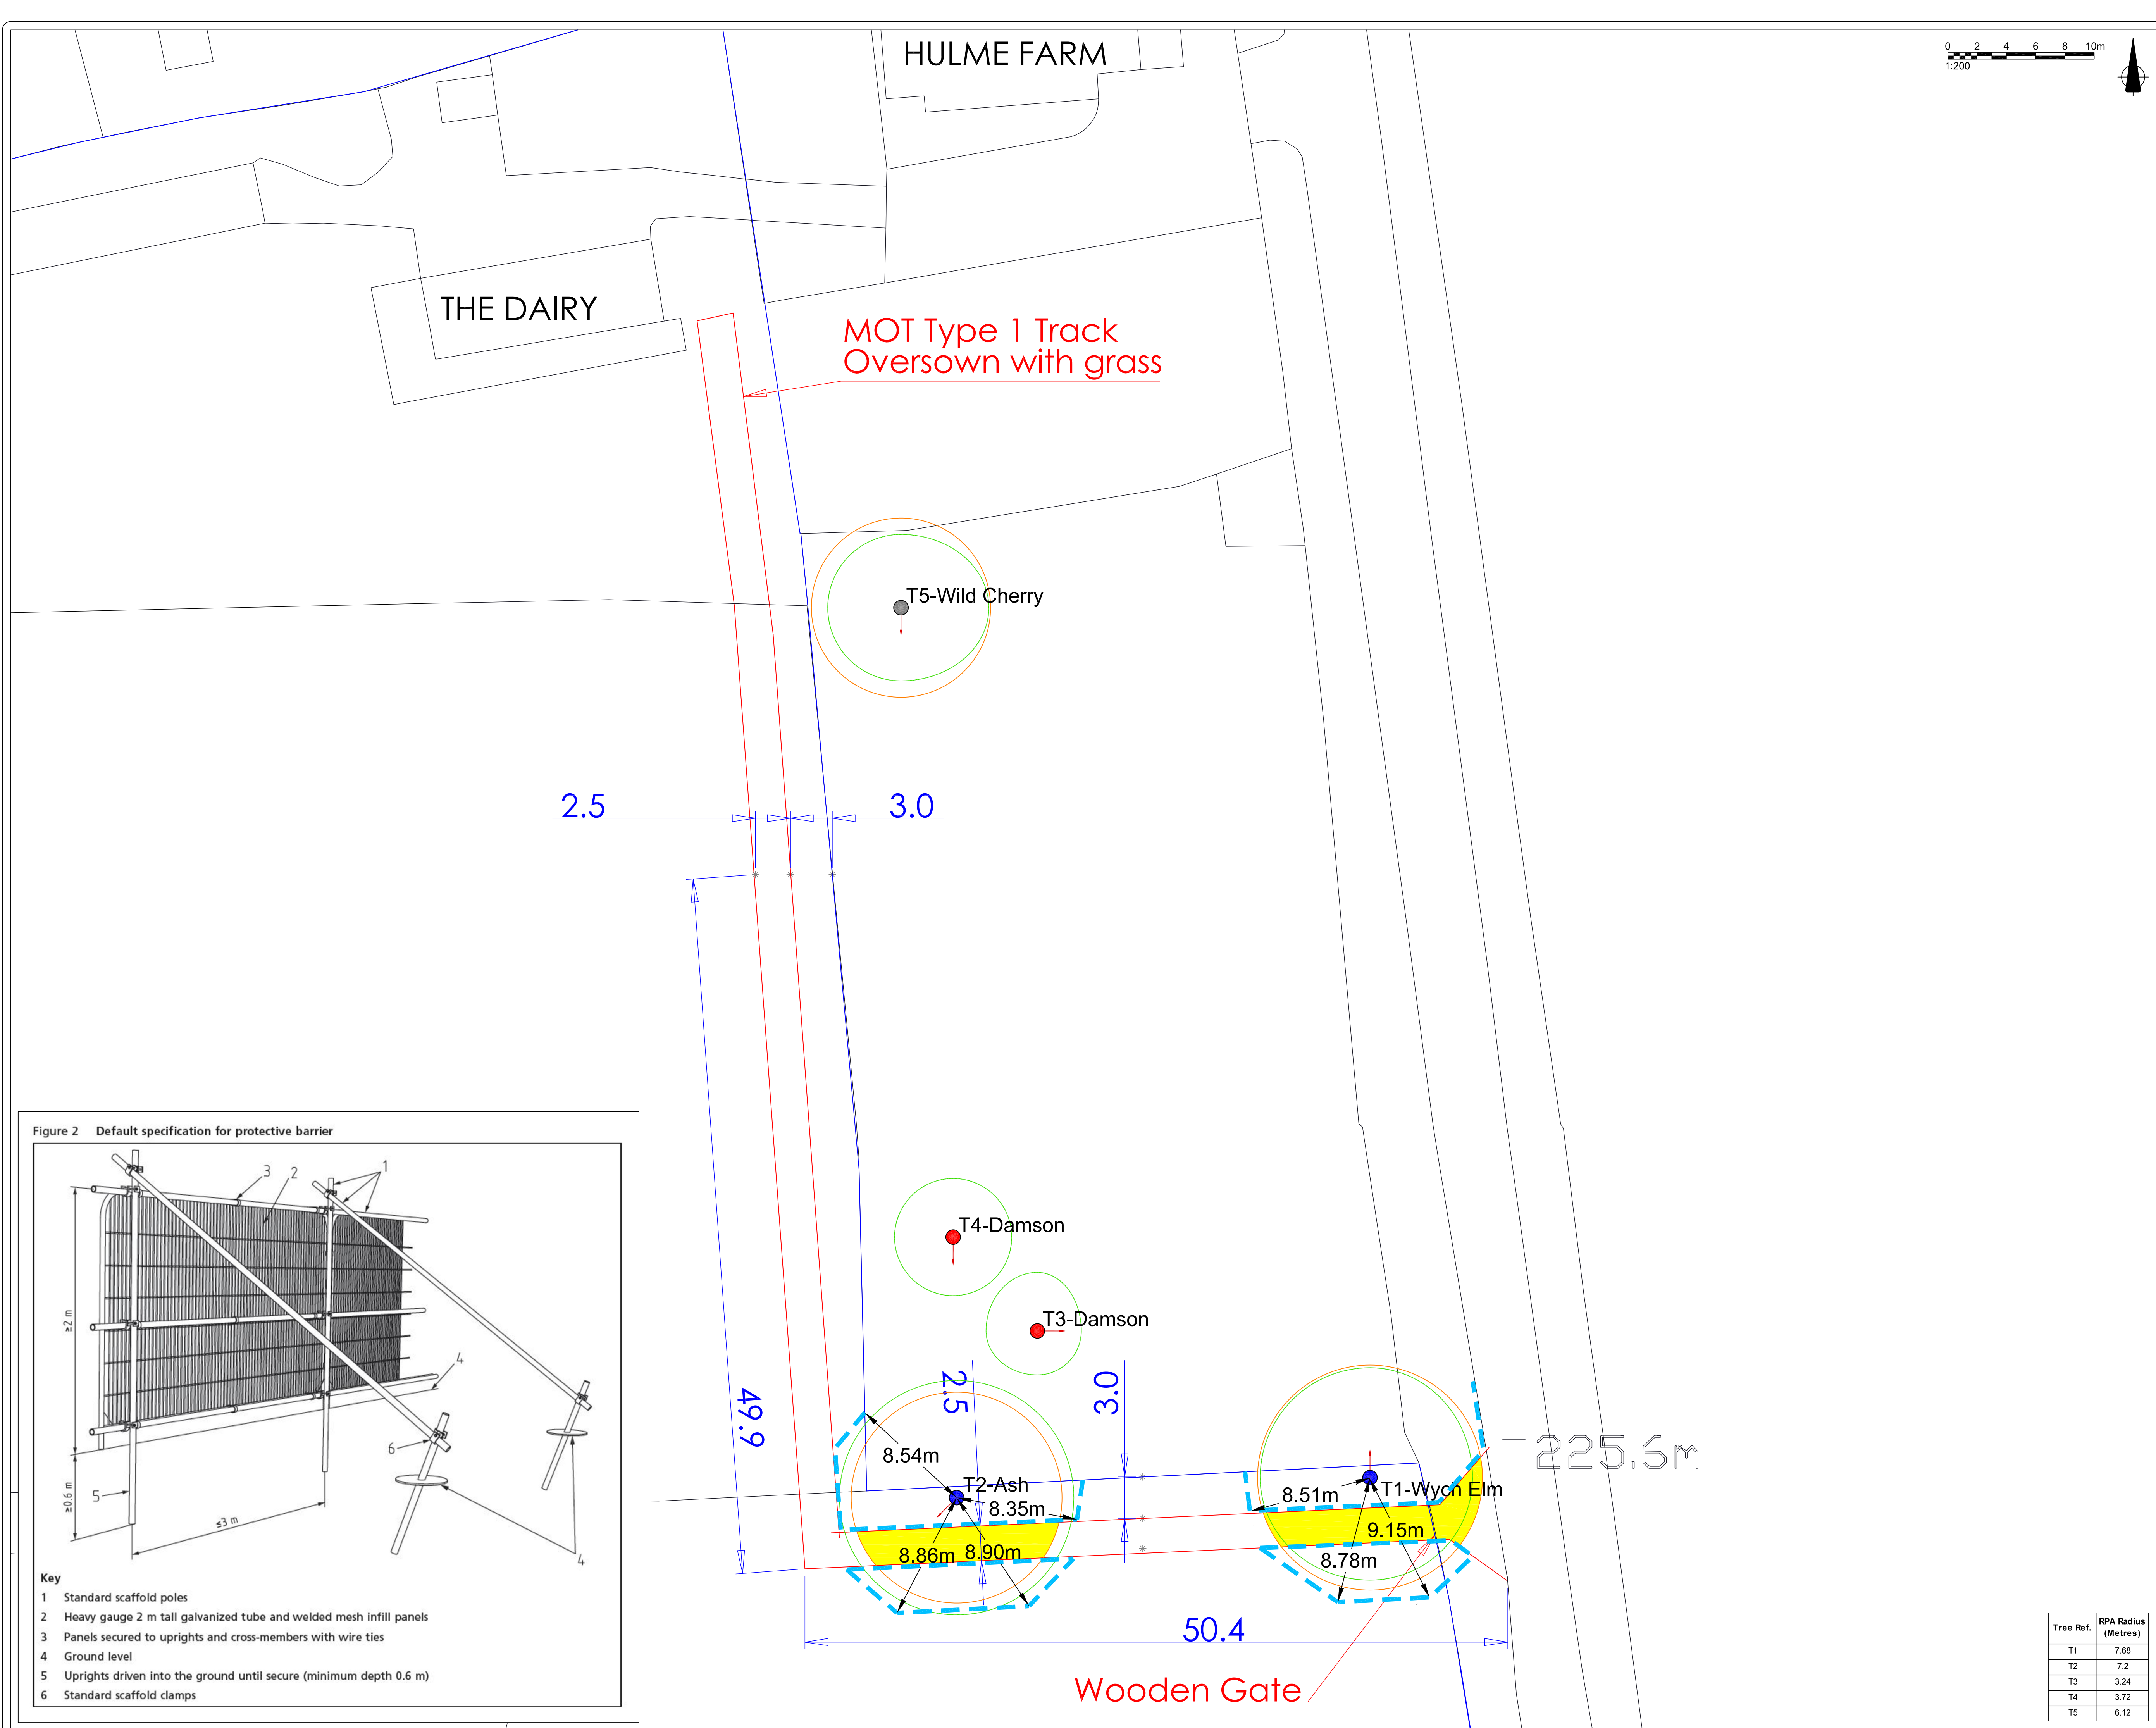

Notes:

1. Contractors are advised to check all dimensions against the tree schedule. Tree canopies are symbolic only and are representative of the average spread; this may not represent the true outline. Note that the tree stem may not sit centrally to canopy. Tree stems are symbolic only and are representative of the tree category; this does not represent the stem diameter - see schedule for details.

2. The original of this drawing was produced in colour - a monochrome copy should not be relied upon.

Rev.	Date:	Status/Amendments:	By:

Key:

- Category A Tree / Group
- Category B Tree / Group
- Category C Tree / Group
- Category U Tree / Group
- Branch Spread
- Tree to be Removed
- Root Protection Area (RPA)
- First Significant Branch Direction
- Tree Protection Barrier
- Special Measures
- Tree Shadow

GROWING SINCE 1992

TREE HERITAGE

Tree Heritage Ltd, Unit 1 Sneyd Mill, Sneyd Street, Leek, Staffordshire, ST13 5HP
Telephone: 01538 384019
treeheritage.co.uk • info@treeheritage.co.uk

Client:

Lee Doyle

Project:

The Dairy, Dalebank Road, Freehay, ST10 1RE

Drawing Title:

Tree Protection Plan

Scale:

1:200

Paper Size:

A1

Drawing Number:

THL-0967-2

Date Created:

21/06/2021

Figure 2 Default specification for protective barrier

Key

- 1 Standard scaffold poles
- 2 Heavy gauge 2 m tall galvanized tube and welded mesh infill panels
- 3 Panels secured to uprights and cross-members with wire ties
- 4 Ground level
- 5 Uprights driven into the ground until secure (minimum depth 0.6 m)
- 6 Standard scaffold clamps

Tree Ref.	RPA Radius (Metres)
T1	7.68
T2	7.2
T3	3.24
T4	3.72
T5	6.12

Appendix D

Construction of Roads and Footpaths through Trees

Special measures should be taken to ensure no damage occurs. A “no dig method” of construction should be adopted.

- 1.1 It is essential to protect the RPA of the trees from the start of operations and that the Tree Protection Fencing is erected before any construction work or site clearance begins.
- 1.2 A “no dig method” means; Roots must not be severed, cut or broken. Ground levels must not be changed. Soil must not be compacted. Oxygen must be able to diffuse into the soil beneath the engineered surface.
- 1.3 The road or footpath should be designed to sit on top of the existing ground level without any excavating. This may mean adjusting the levels elsewhere to avoid sudden changes in levels around the trees.
- 1.4 If a “Tarmac” surface is used it should be permeable to allow water and gas exchange. If the surface is “Block Paving” then no pointing should take place to allow water and gas exchange.
- 1.5 Examples of a possible construction methods are shown below in Figures 1 and 2 using a 3D cellular confinement and load spreading system.

Figure 1

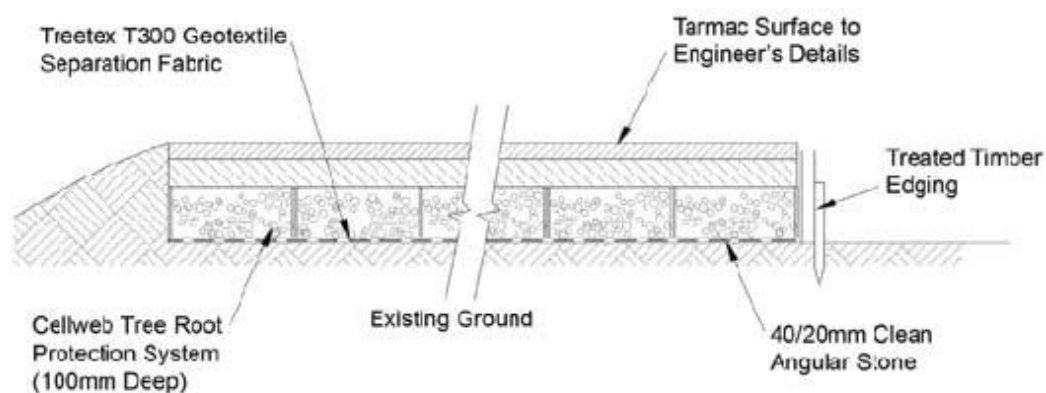


Figure 2

