

APPENDIX I

IVY HOUSE FARM, ROWNALL - SUPPLEMENTARY PHOTOGRAPHS



Pl. 1 Eastern bay with four-light window and small mullioned and chamfered window to the left, approved in 1992

Pl. 2 The same elevation photographed circa 1984. Although the mullioned windows are eroded in this image, their buff colour is distinct. The position of the first floor windows relative to those on the two western bays of the farmhouse, and subtle differences in the masonry (no longer evident) are two indications that the upper floor windows may have been part of an adaptation to raise the building from a single storey wing to a two-storey structure, at which time the staircase window in the gable end would have been added.





Pl. 3 View of the south-facing elevation. The modern porch of 1984 covers the original entrance doorway into the Houseplace or Hall. The open cartshed to the left is a later 19th century alteration and may relate to the documented presence of a 'carter' at Rownall in the 1861 and 1871 census returns.



Pl. 4 Photograph of the entire south-facing elevation taken circa 1984 prior to alterations.



Pl. 5 (above) Rear elevation looking south from the raised and embanked lawn.

Pl. 6 (below) The orange highlight represents a 20th century alteration to insert a window with a concrete lintel, the yellow highlight is the reconstructed utility, on the footprint of an earlier 20th century rear porch.





Pl. 7 Eastern gable end. This elevation has undergone considerable alteration. The larger masonry courses towards the gable suggest a large area of reconstruction, possibly undertaken in the 18th century. The original stone coped gable has also been removed. There are indications that this part of the building may have originally been a single-storey kitchen wing using the earlier cruck trussed frame, which would account for the change in masonry. When it was altered in the later 17th century and raised to two storeys, a staircase window was inserted.


Pl. 8 yellow highlighted masonry dates from the 1992 repair, whilst the orange highlight is a 20th century alteration





Pl.9

Northern gable to the dairy / kitchen wing. The presence of large blocky stones, cut and dressed, reveal that this gable was once much narrower with a raised coped gable.

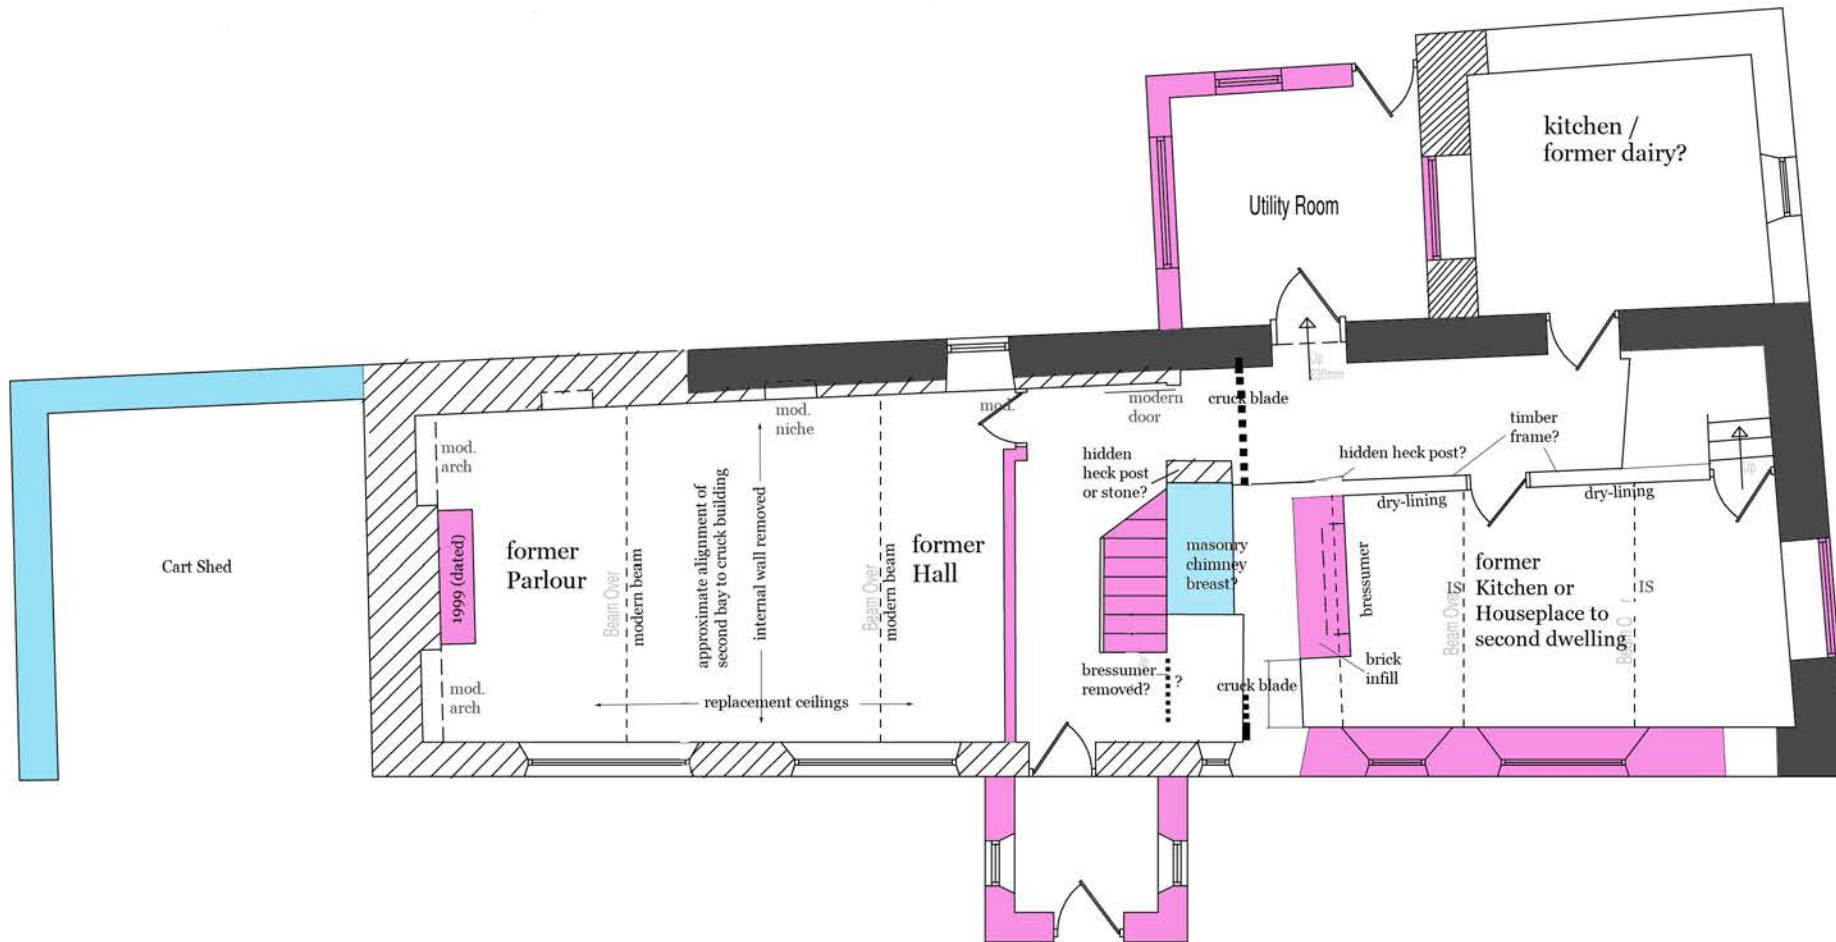

GROUND FLOOR Suggested Phase Plan